



Szybkozłącze grzybkowe ISO A

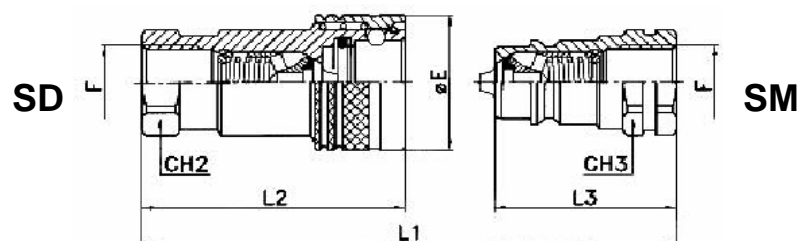

Kod Maron	Średnica przelotu	Gwint	CH 2	CH 3	E	L 1	L 2	L 3
SM1/4"	6	1/4"	19	19	26	70	49	35
SD1/4"								
SM3/8"	10	3/8"	22	22	30	85	60,5	42,5
SD3/8"								
SM1/2"	13	1/2"	27	27	38	96	70	48
SD1/2"								
SM3/4"	20	3/4"	34	34	45	114	84,5	57
SD3/4"								
SM1"	25	1"	41	41	52	131	99	65,5
SD1"								
SM1"1/4"	30	1 1/4"	50	50	70	150	117	75
SD1"1/4"								

Szybkozłącze sucho odcinane "FLAT FACE"

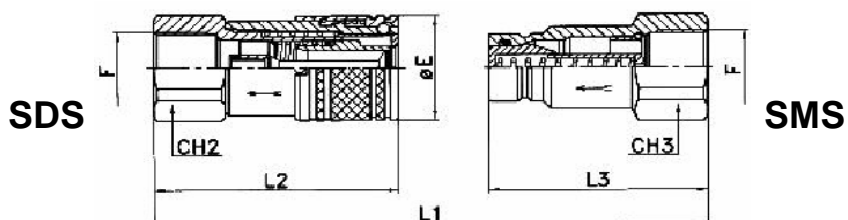

Kod Maron	Średnica przelotu	Gwint	CH 2	CH 3	E	L 1	L 2	L 3
SMS1/4"	6	1/4"	22	22	27	96	52,5	53,5
SDS1/4"								
SMS3/8"	13	3/8"	27	27	32	116	68	63,5
SDS3/8"								
SMS1/2"	13	1/2"	27	27	32	125	73	67,5
SDS1/2"								
SMS3/4"	20	1/2"	32	32	38	137	78,5	76
SDS3/4"								
SMS3/4"	20	3/4"	36	36	38	138,5	84	72
SDS3/4"								
SMS1"	25	3/4"	46	38	48	146	87,5	80,5
SDS1"								
SMS1"1/4"	25	1"	46	46	48	150	87,5	84,5
SDS1"1/4"								